

ULTRAMATIC RX MASTER™ PHOROPTOR® & ILLUMINATED PHOROPTOR® BREATH SHIELD
INSTRUCTION SHEET

Installation

Place the Breath Shield over the Forehead Rest Knob so that it hangs as shown in the images below.

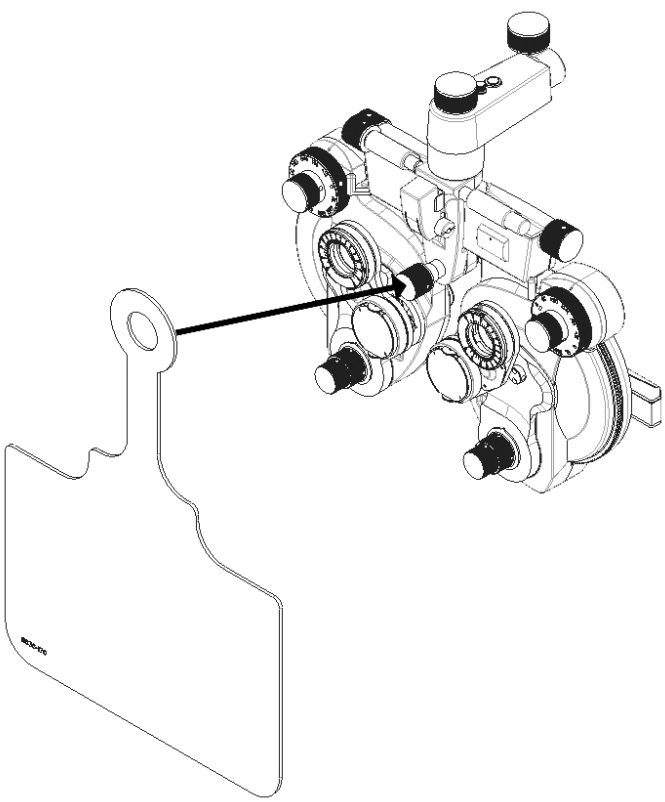

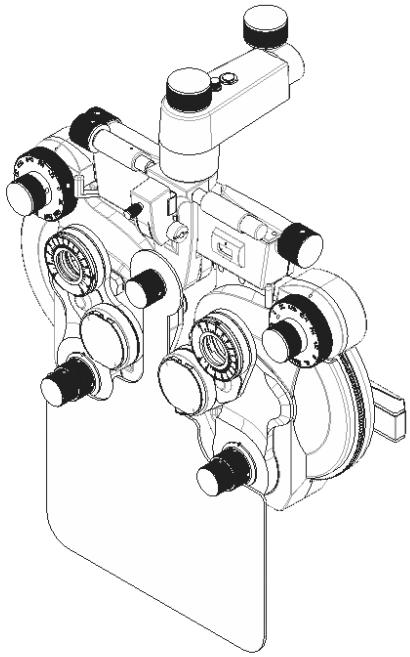

Cleaning

1. Wear a face mask and gloves while cleaning the breath shield.
2. Clean the shield with a clean, soft cloth moistened with an approved cleaning solution*.

Note: Be careful to prevent any cleaning solution from dripping inside the Ultramatic RX Master Phoroptor® or Illuminated Phoroptor® as this may damage the unit.

***Approved Cleaning Solutions:**

- Bleach solution (sodium hypochlorite 5%) diluted to 10 parts water to 1 part bleach (strength is 5000 PPM)
- 70% Isopropyl Alcohol. Be sure to use alcohol in a well-ventilated room, since alcohol is flammable.

PN 11636-105 Rev. A